

Fig 1 Exploded diagram of upper cover assy & hopper

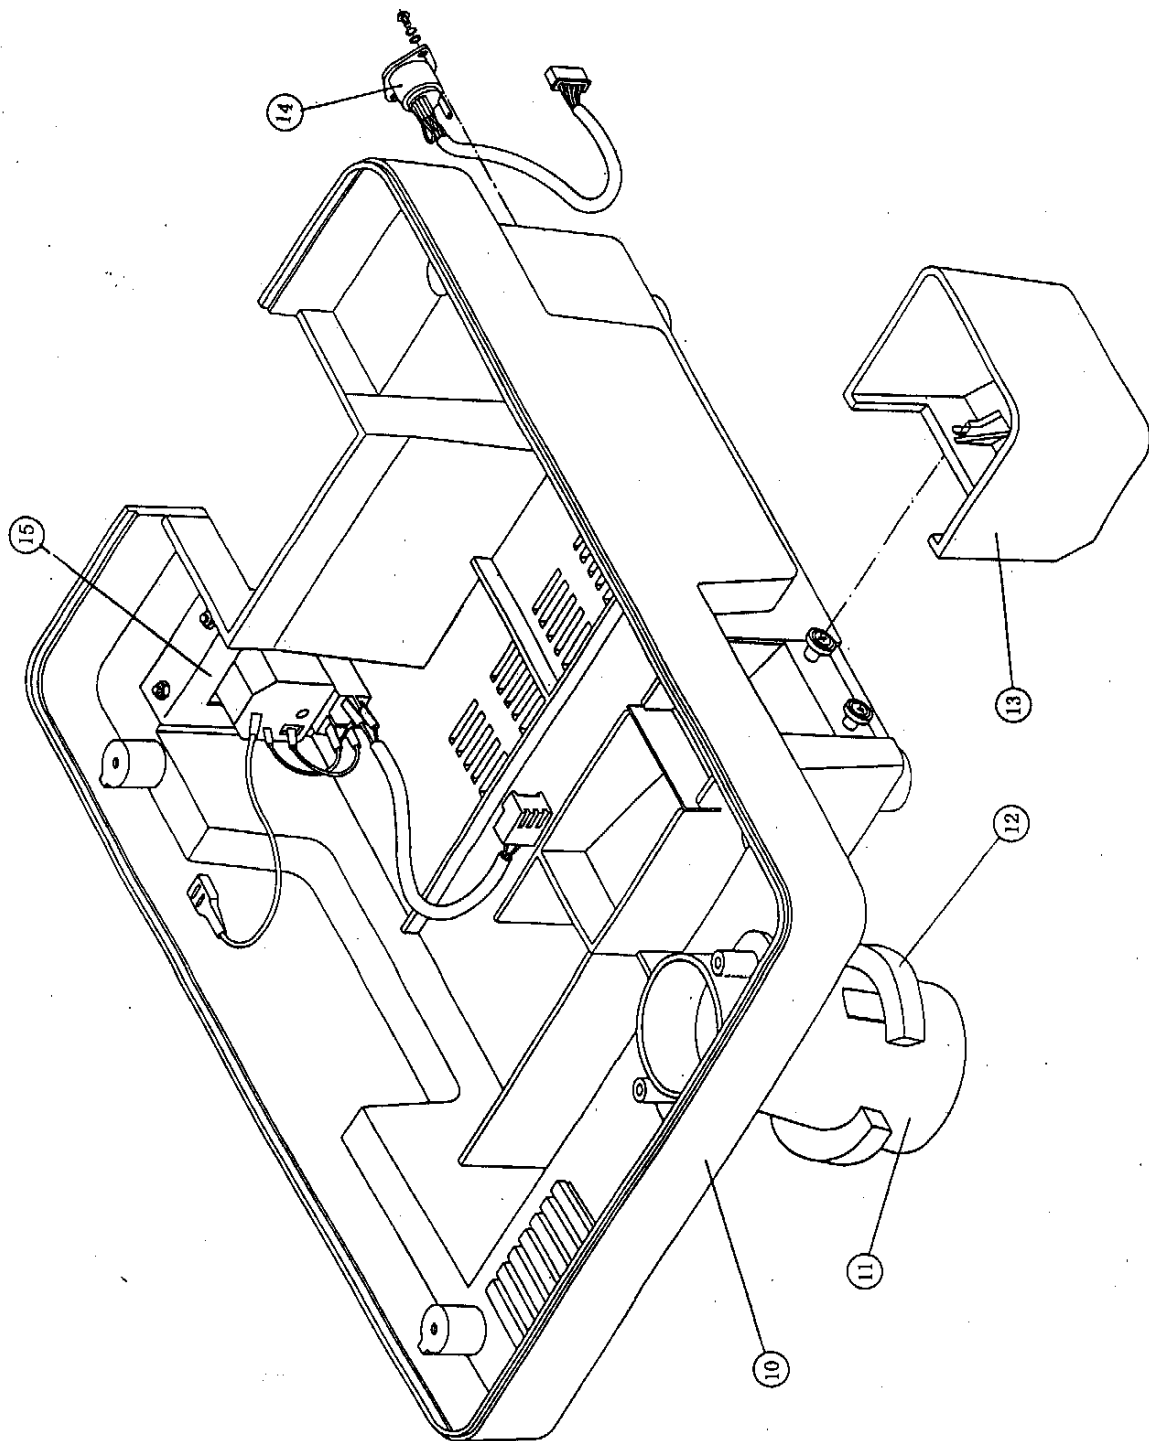


Fig. 2 Bottom cover assembly and rejected coin cup

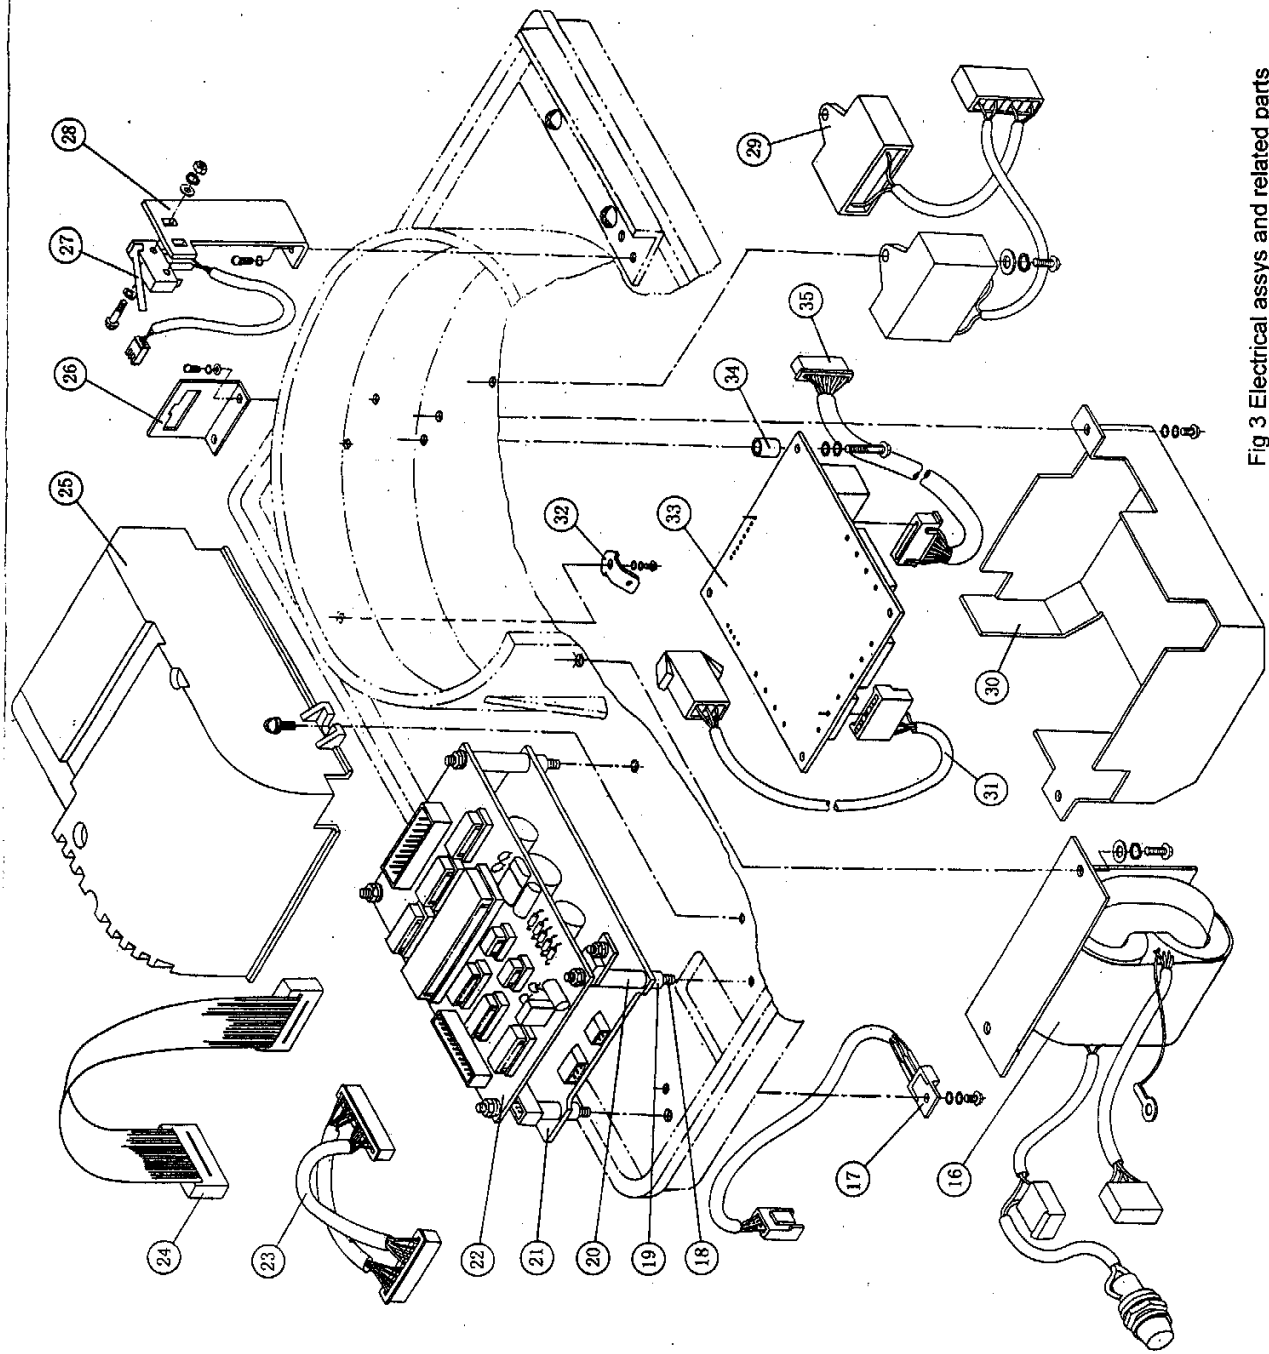


Fig 3 Electrical assys and related parts

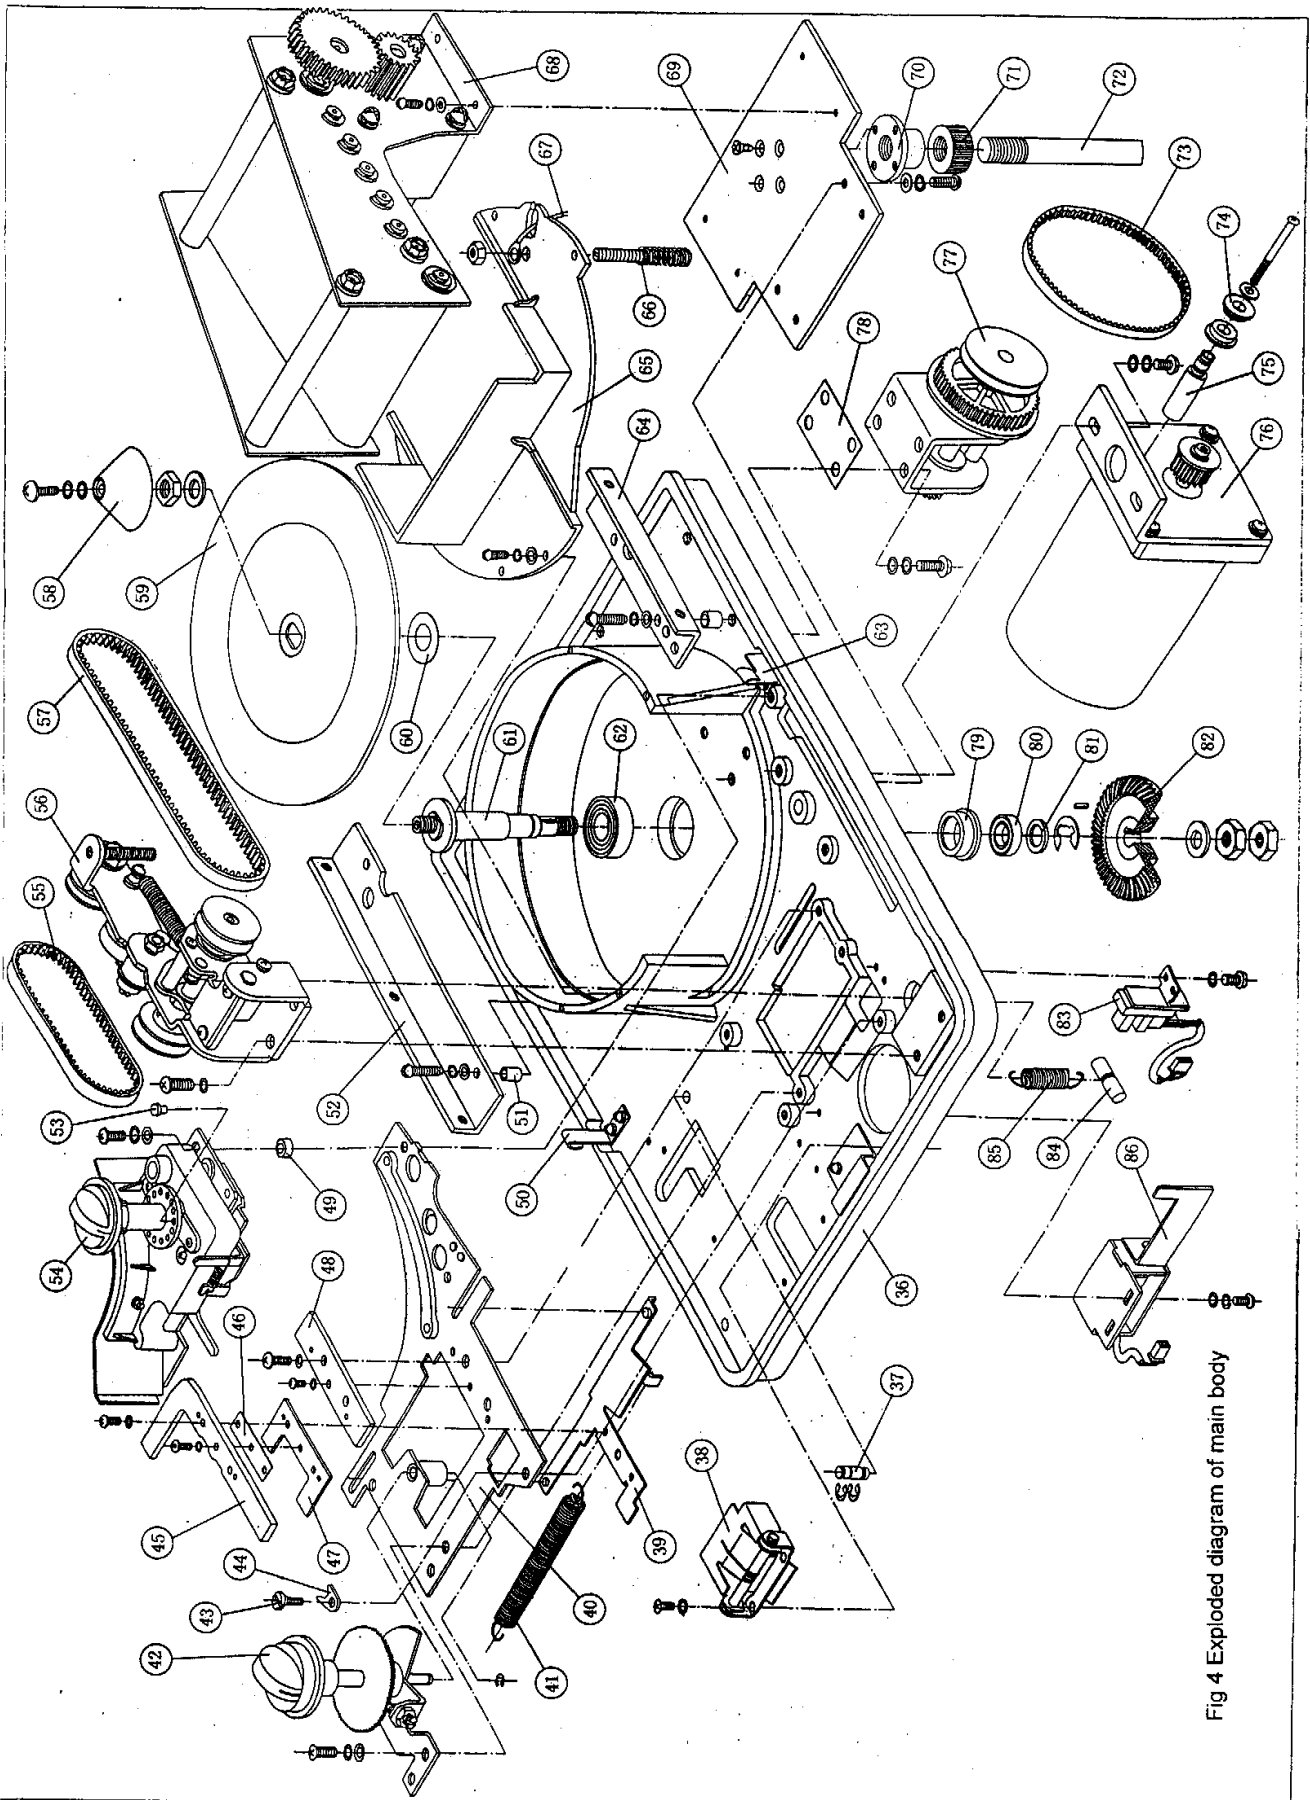


Fig 4 Exploded diagram of main body

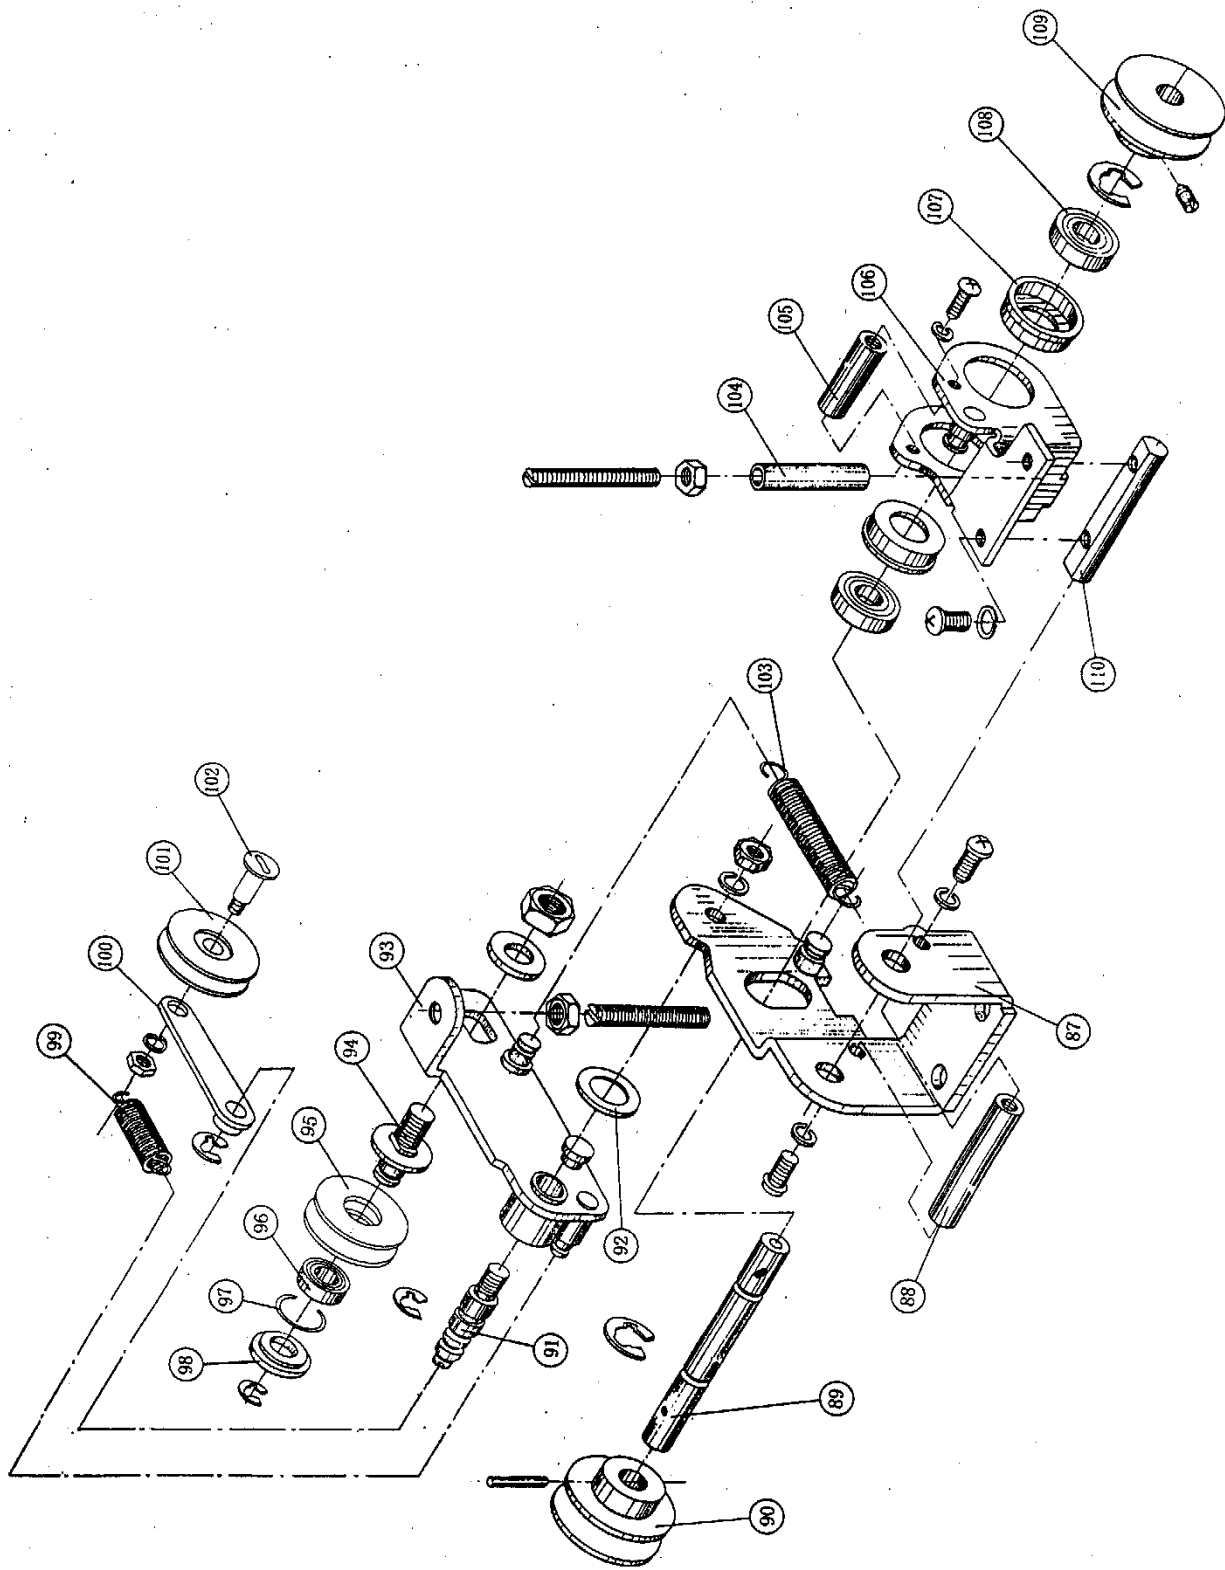


Fig.5 Exploded diagram of feed mechanism assy

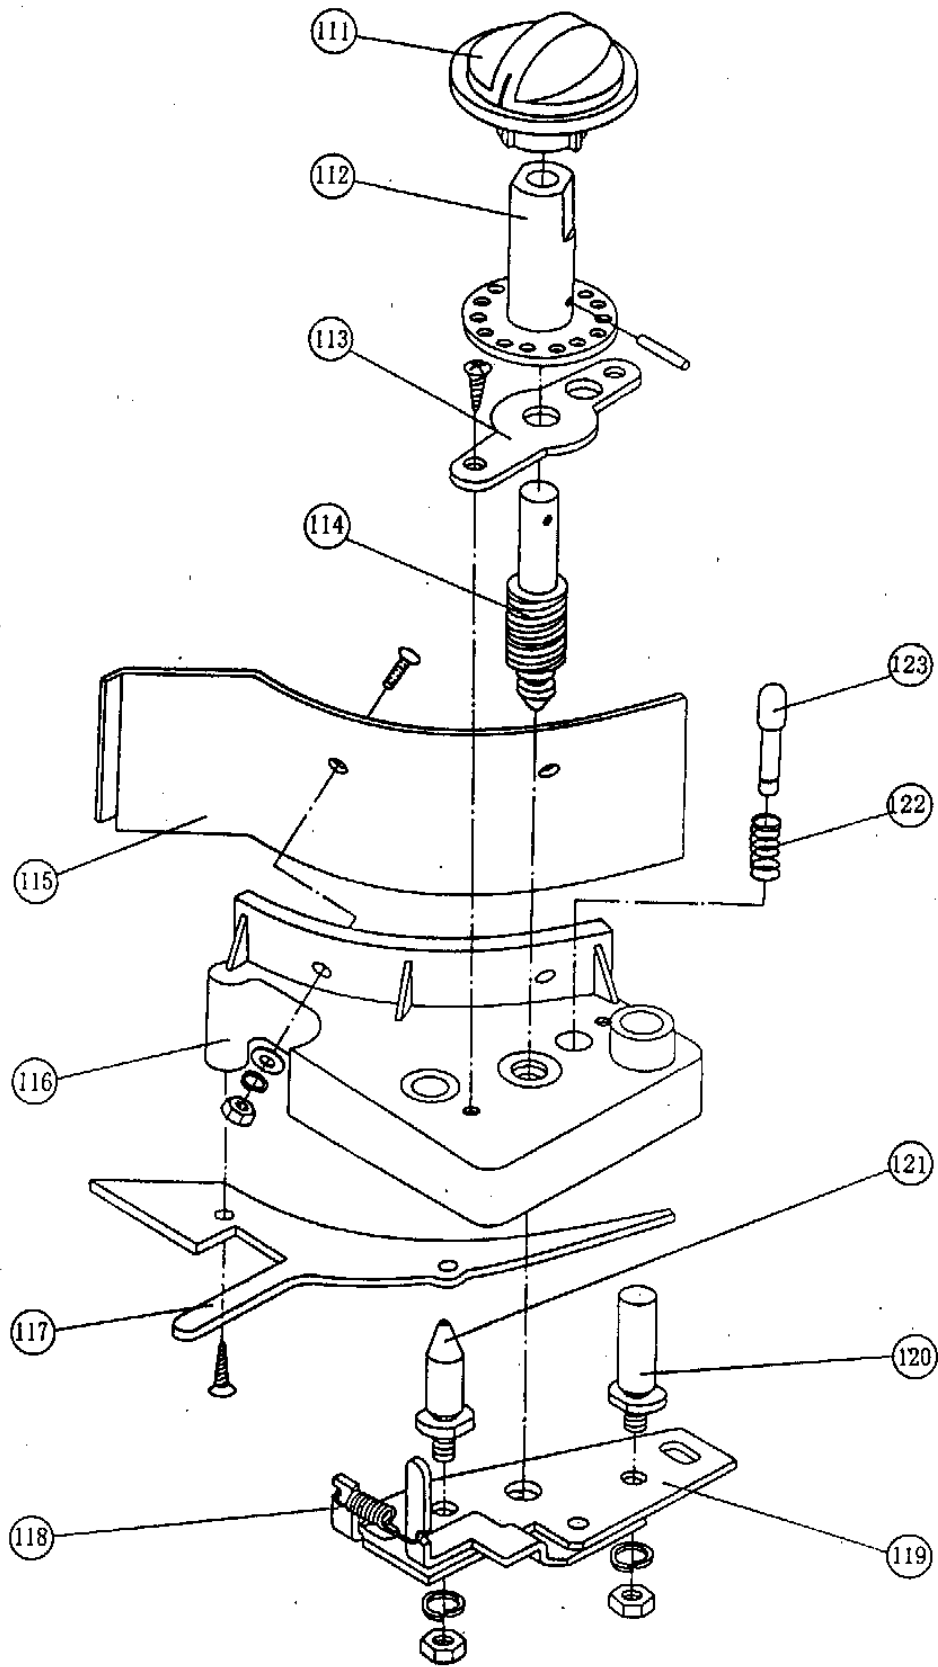


Fig.6 Exploded diagram of thickness adjustment block

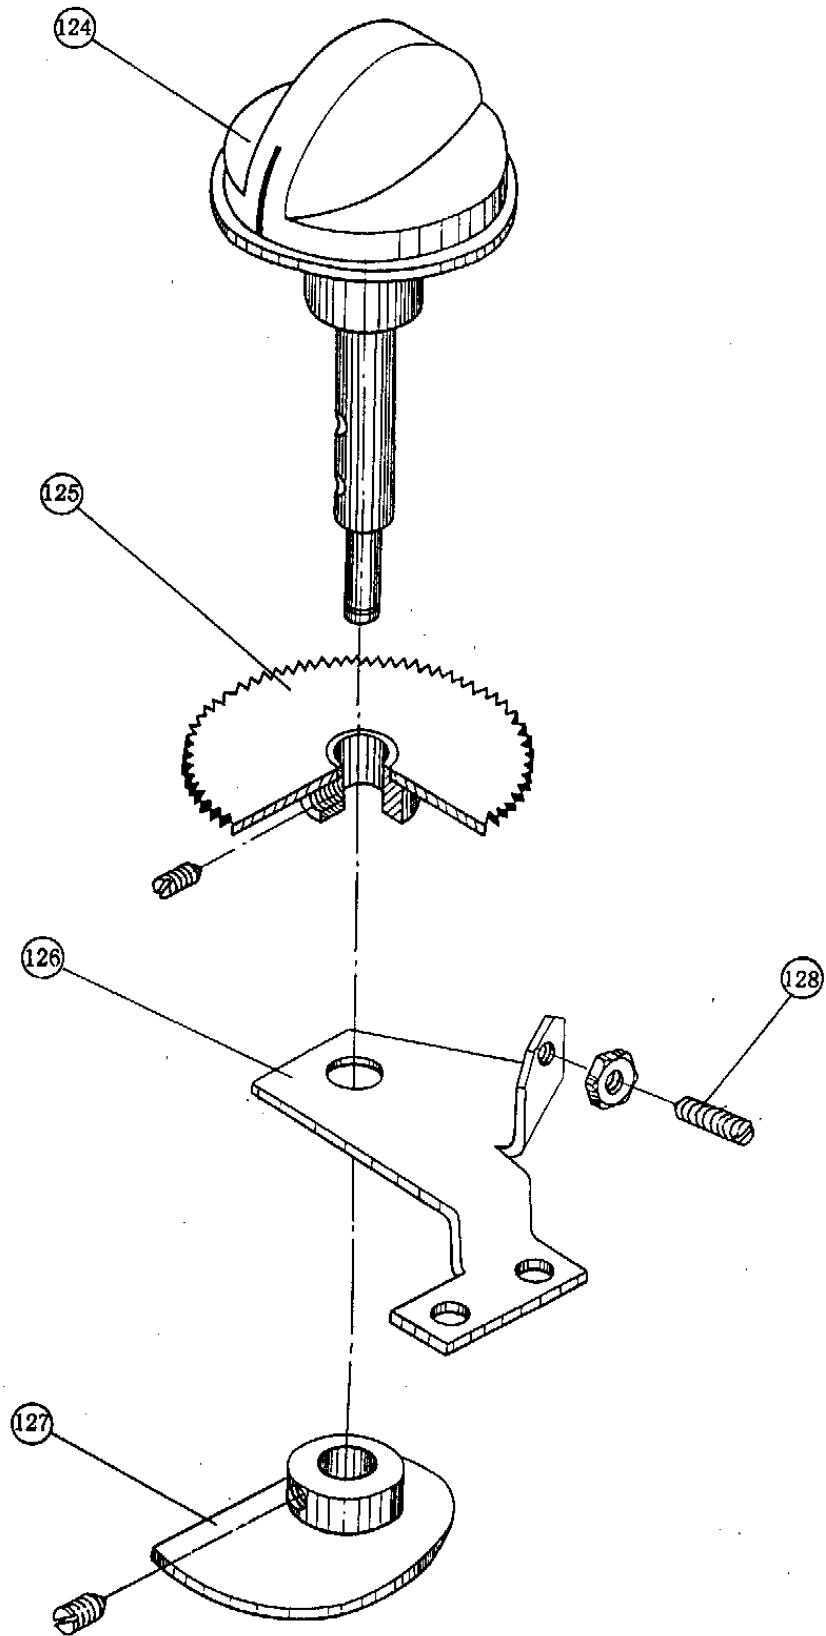


Fig.7 Exploded diagram of cam assy

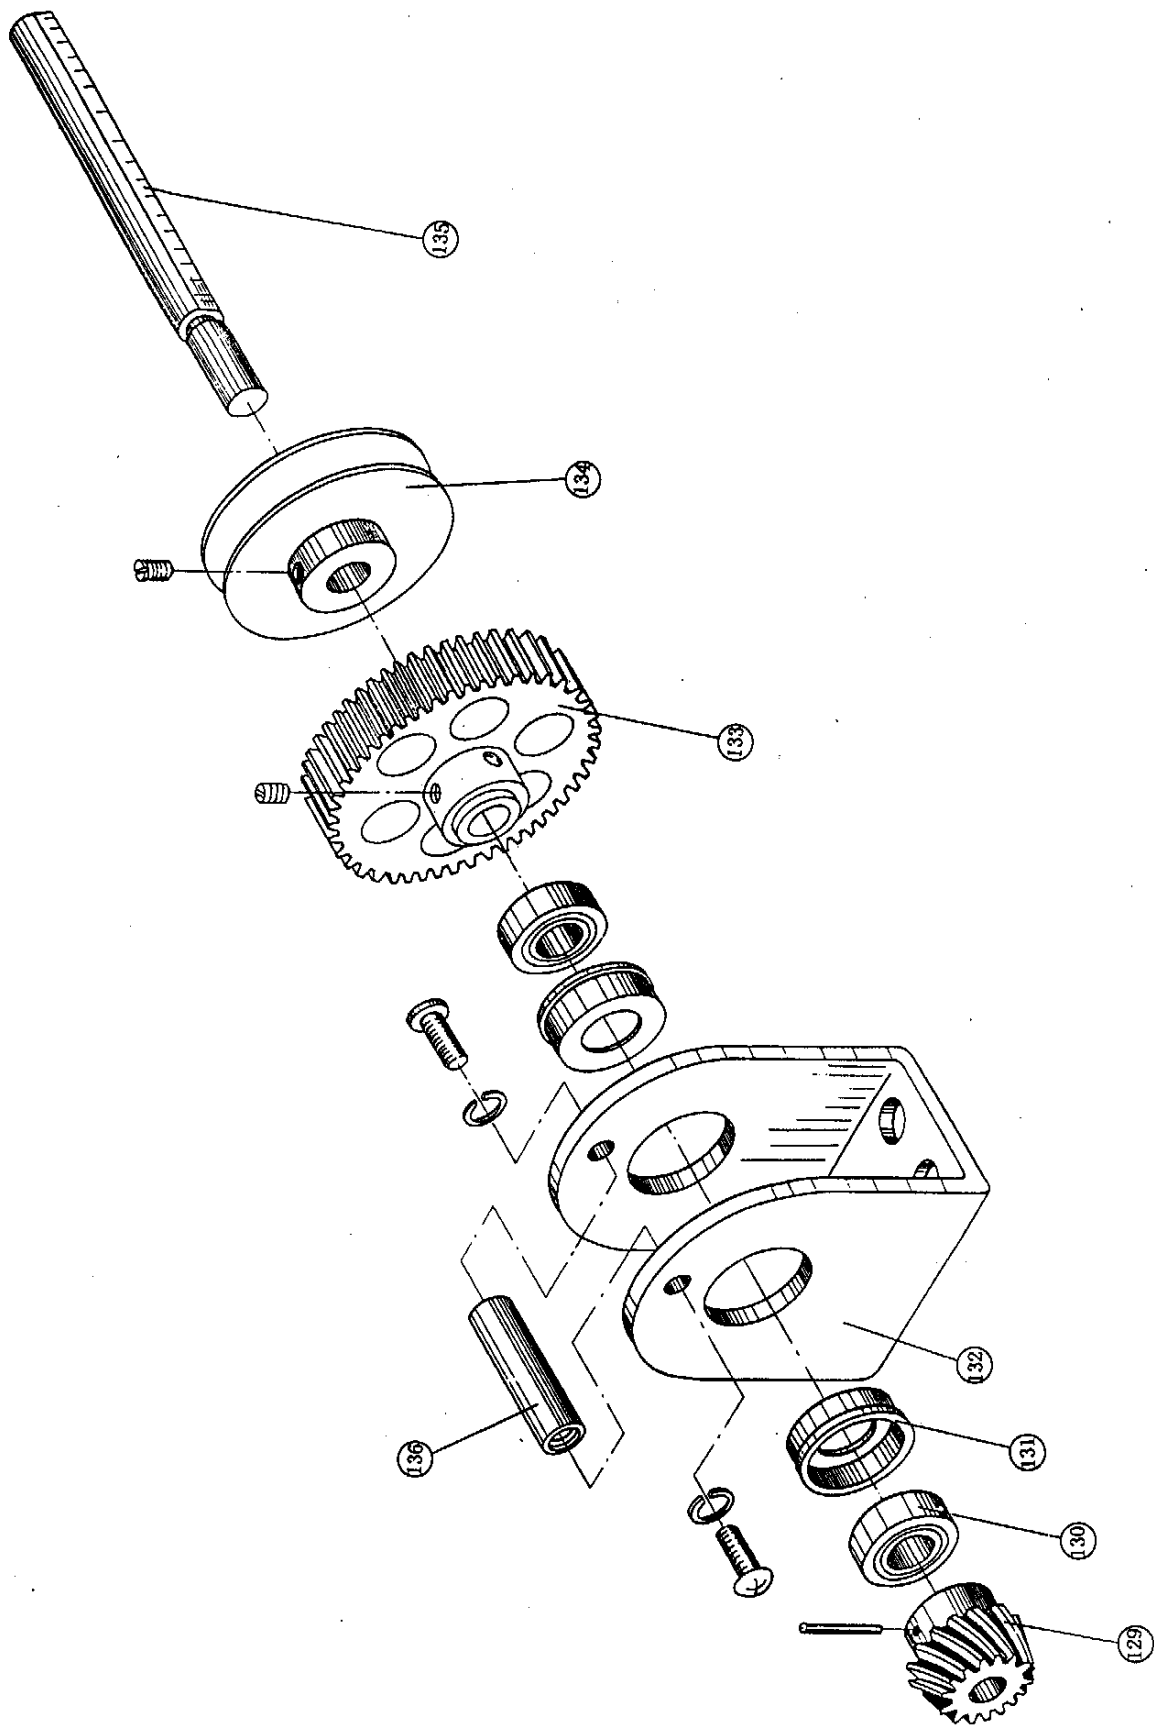


Fig.8 Exploded diagram of minor gear assembly



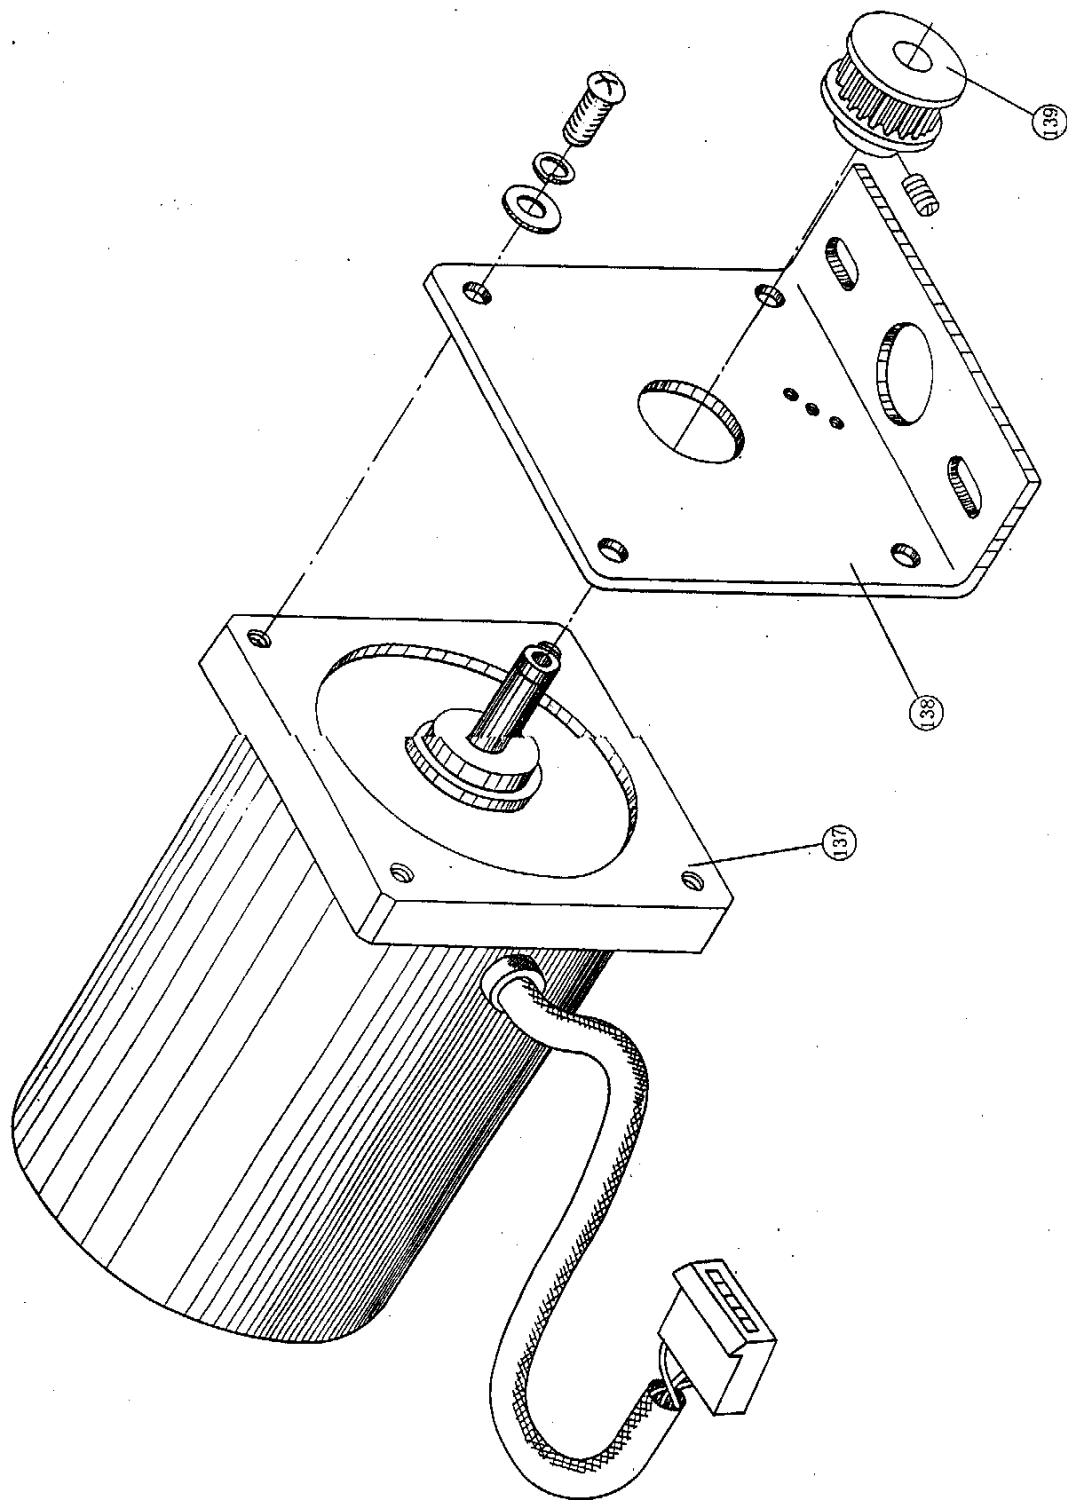


Fig.9 Exploded diagram of lower motor assembly

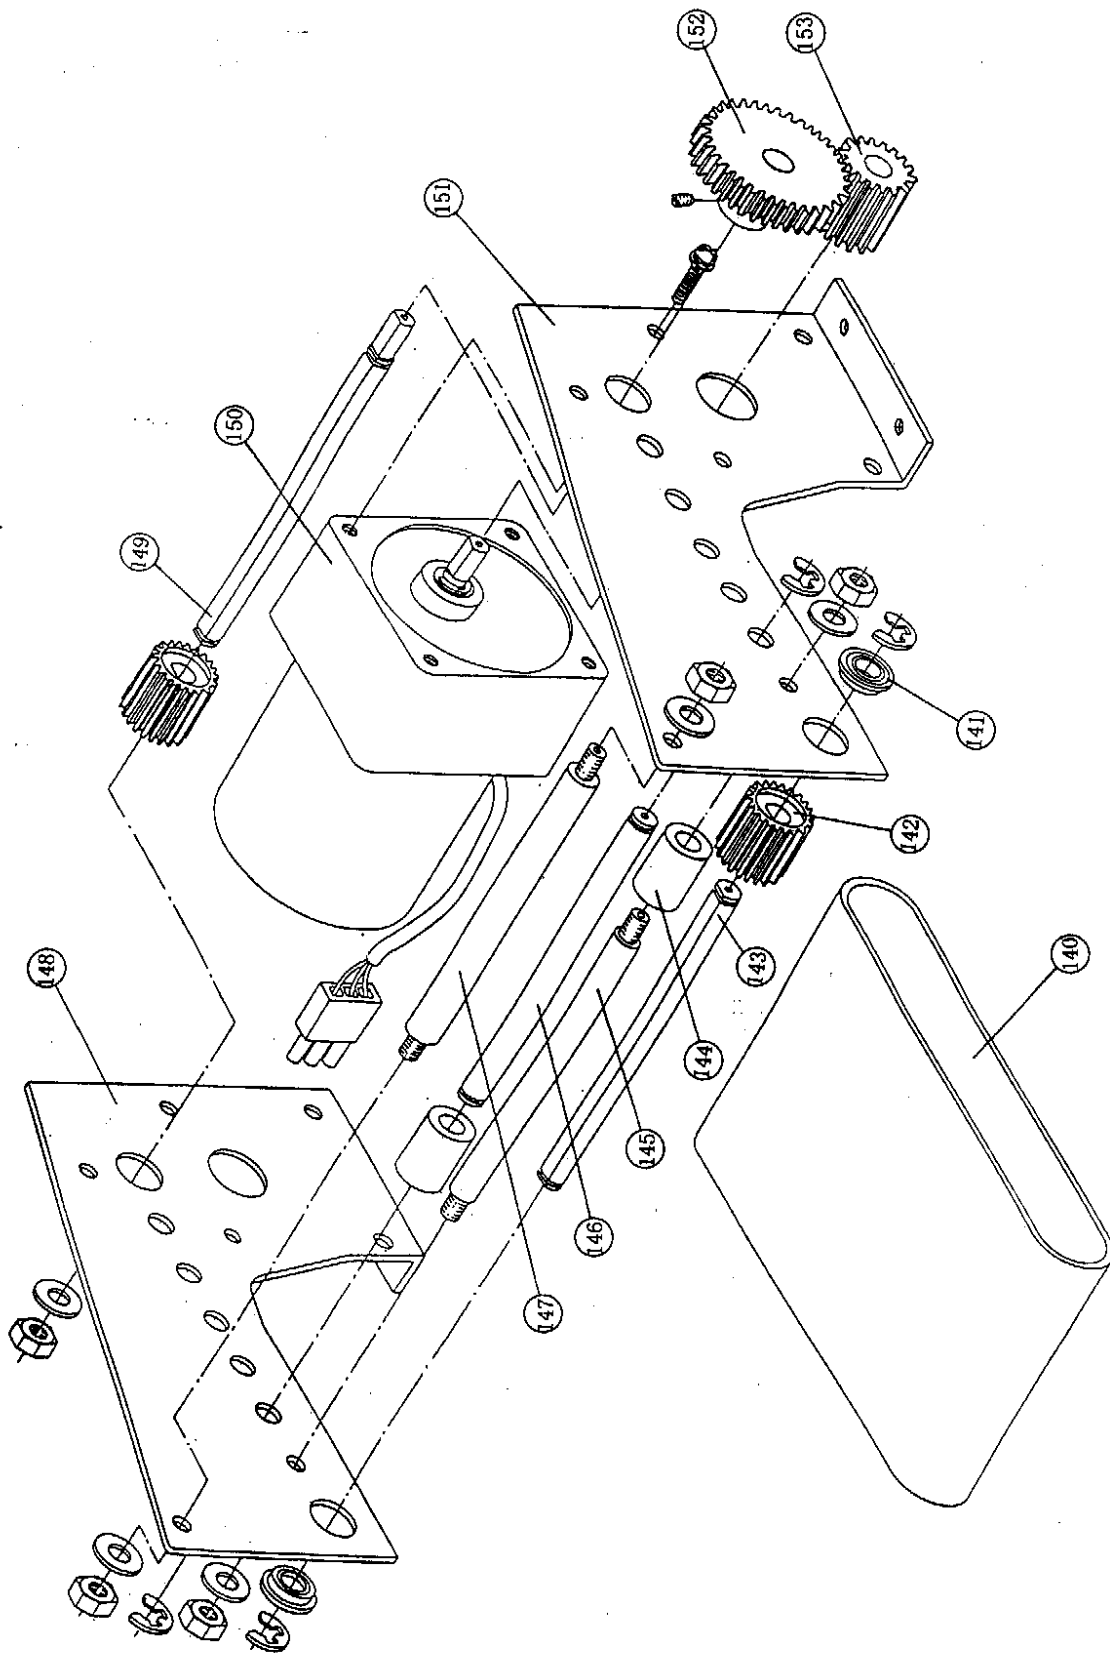


Fig.10 Exploded diagram of conveying belt assembly

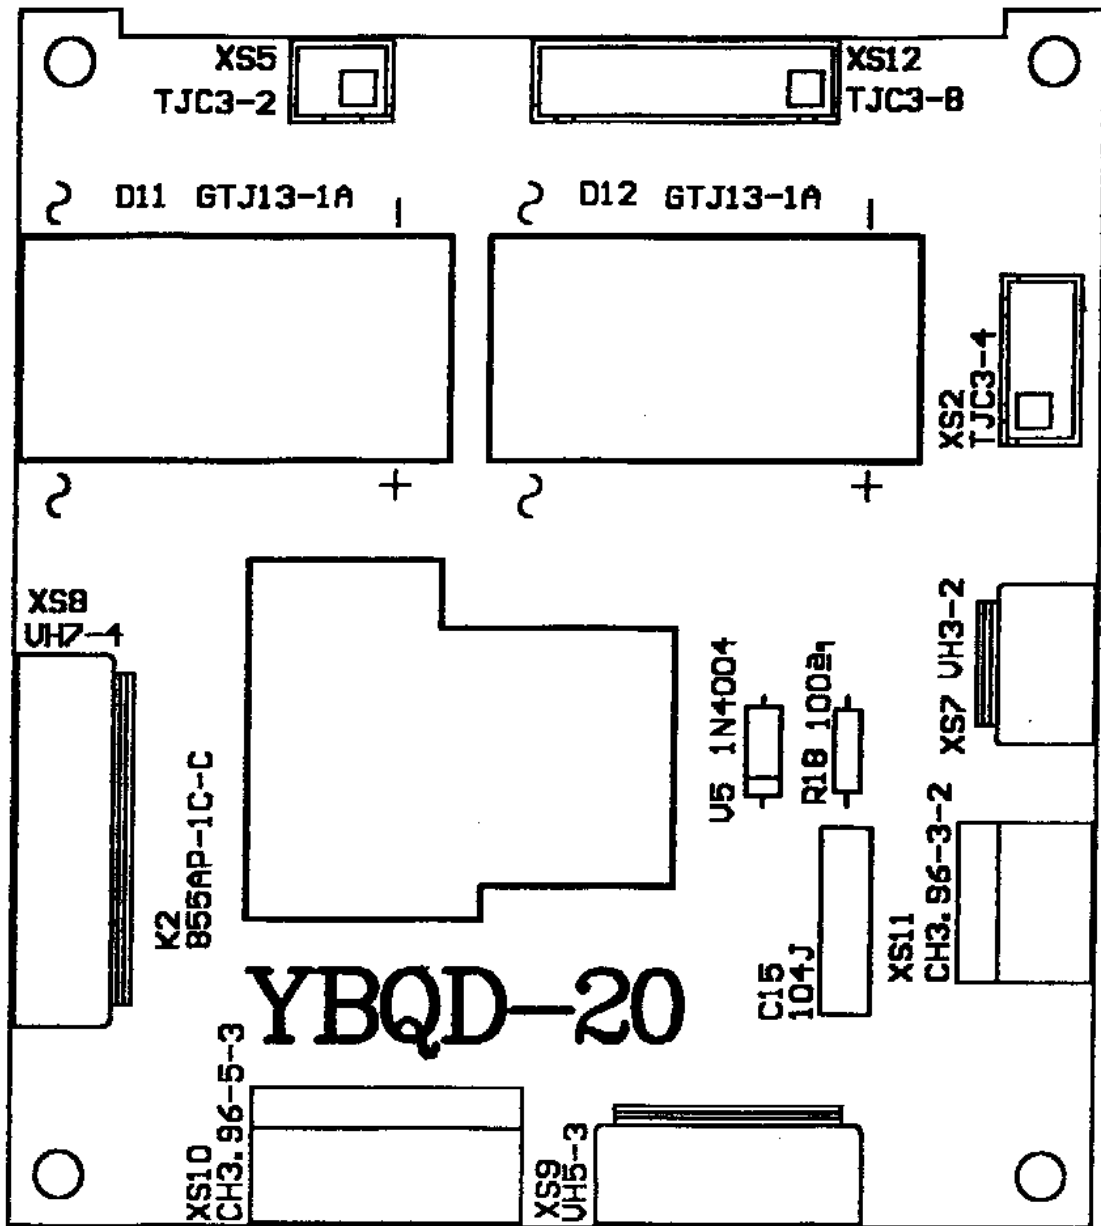


Fig.11 Component installing diagram of AC power supply board

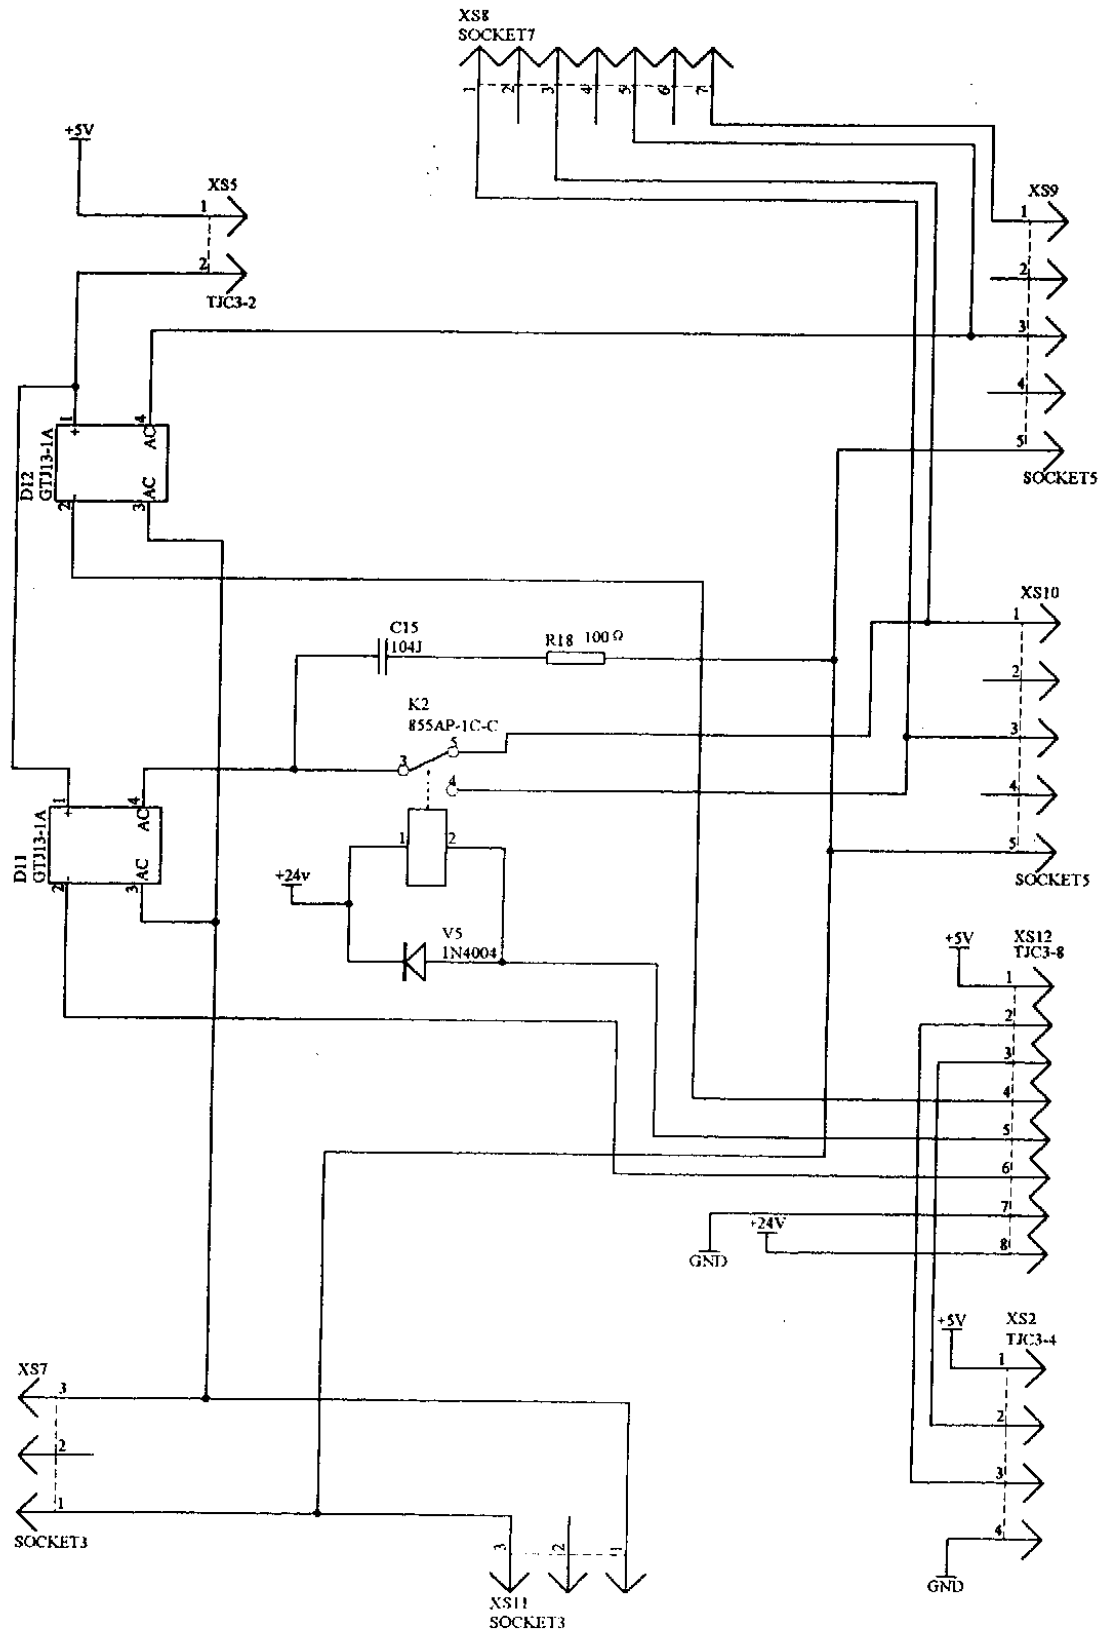


Fig.12 Electric circuit diagram of AC power supply board

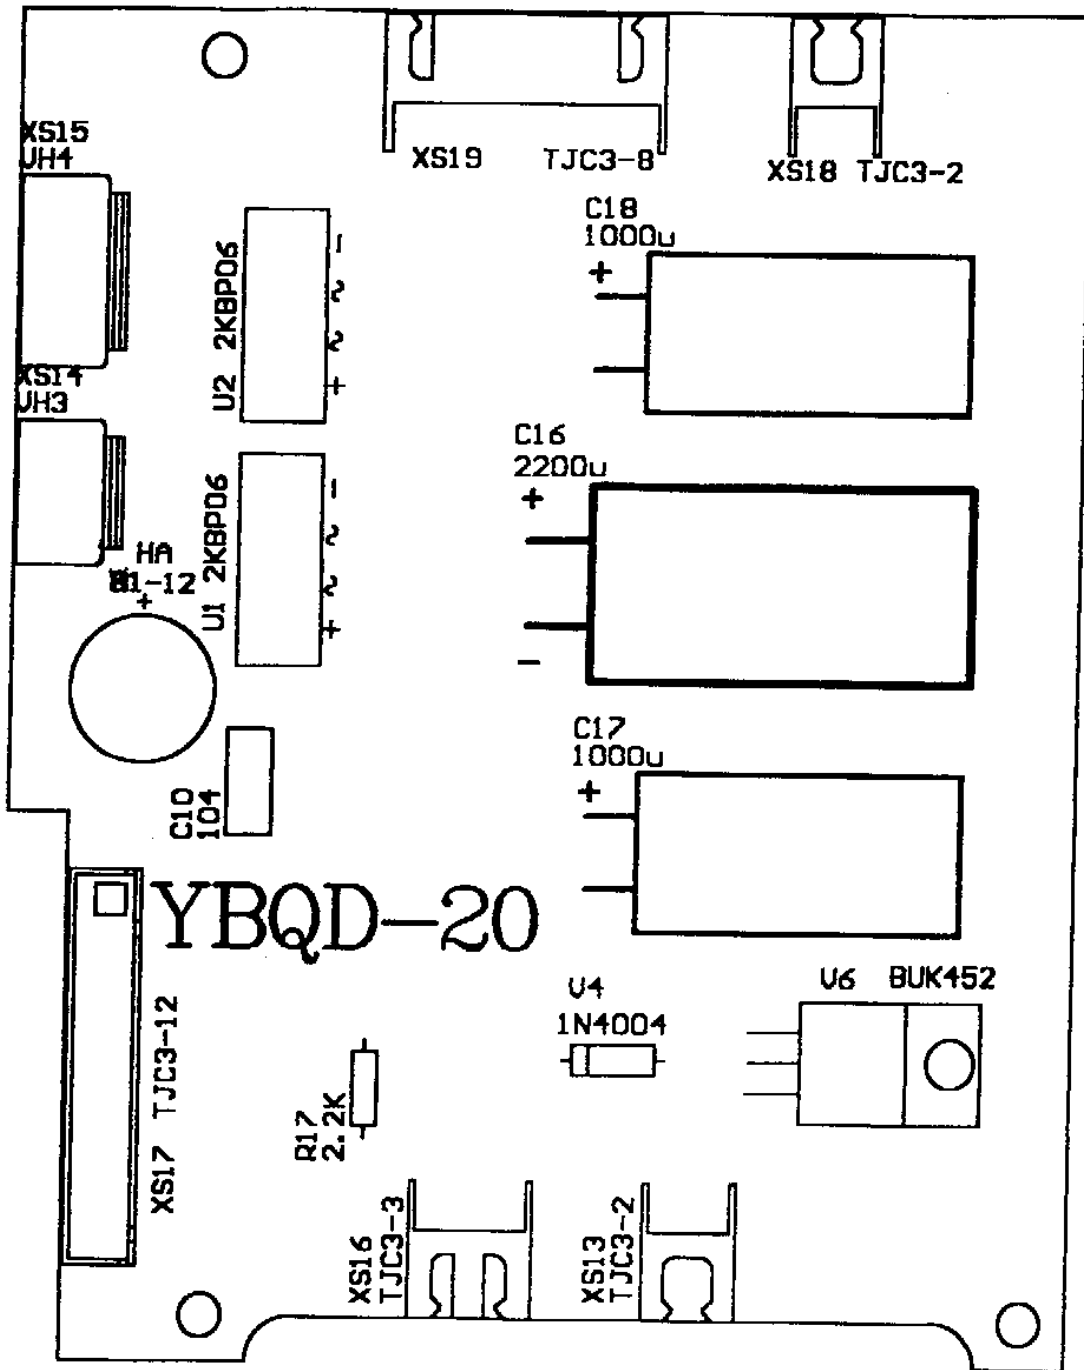


Fig.13 Component installing diagram of DC power supply board

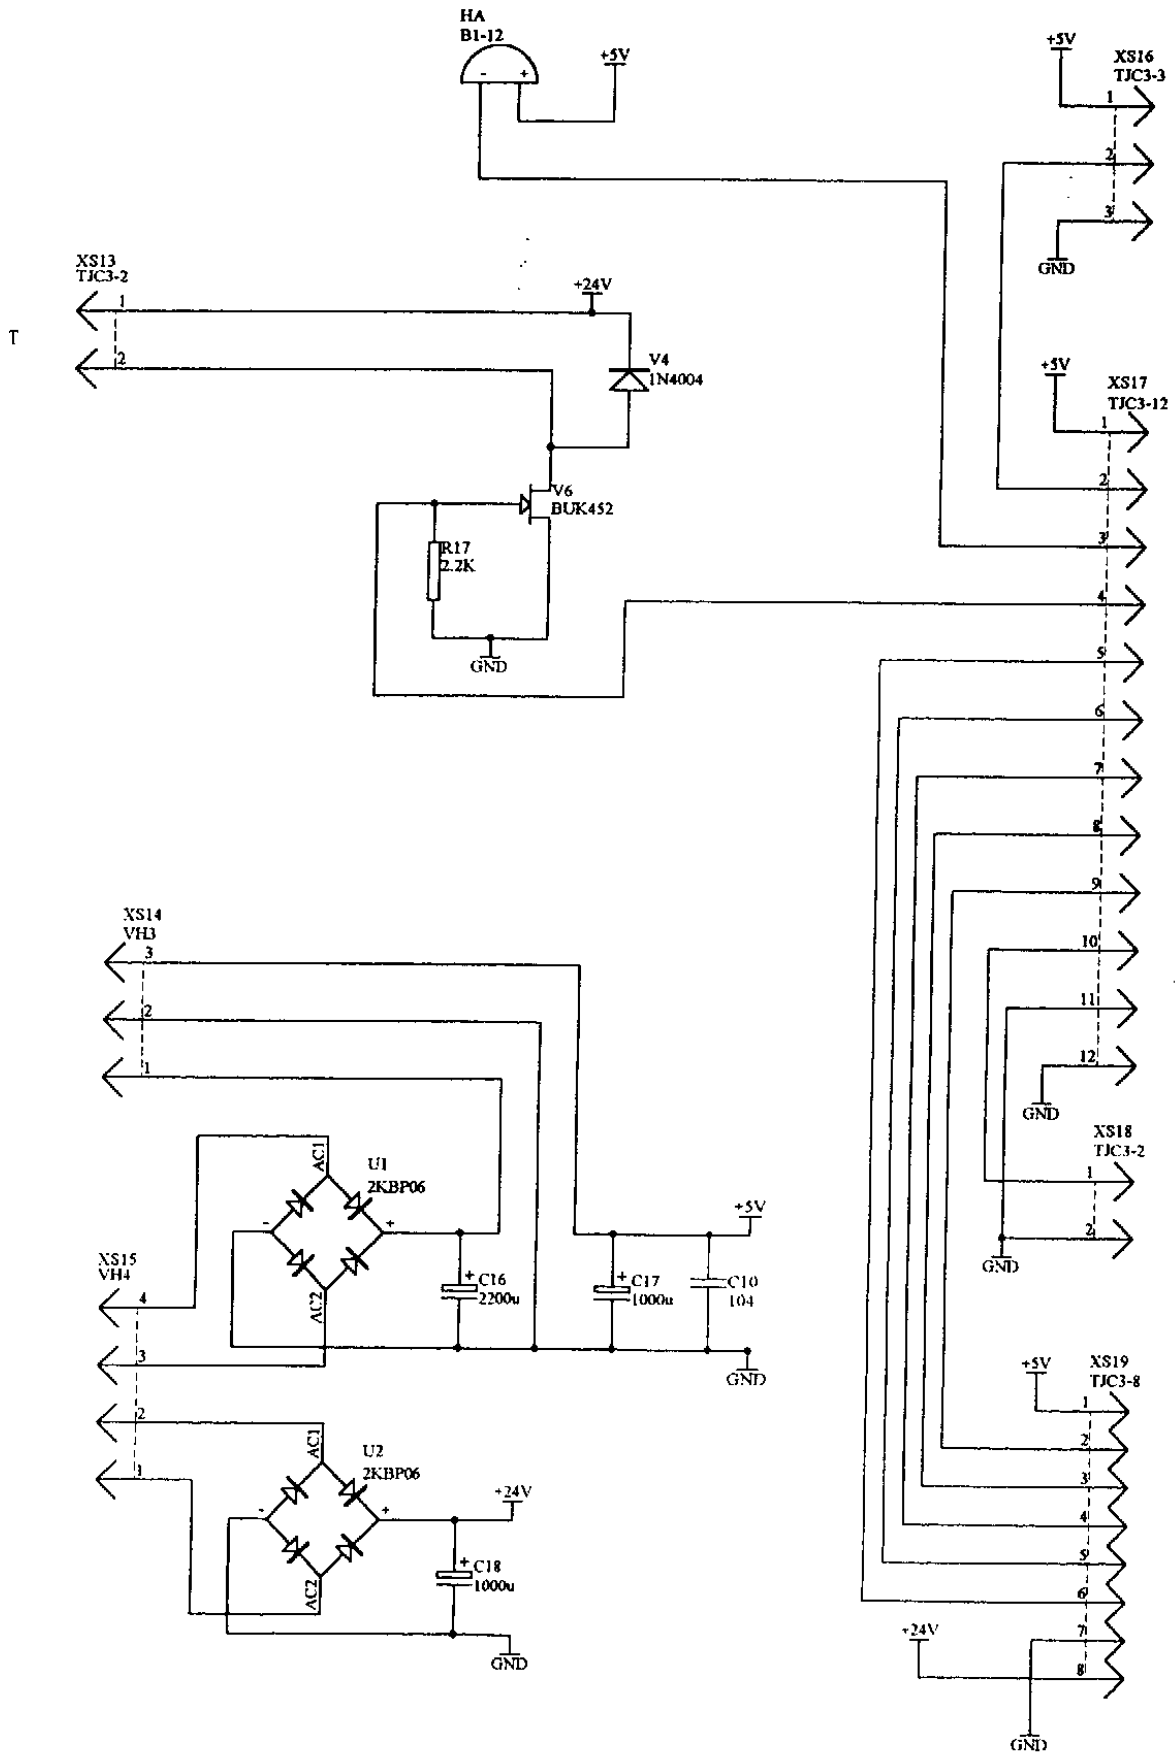


Fig.14 Electric circuit diagram of DC power supply board

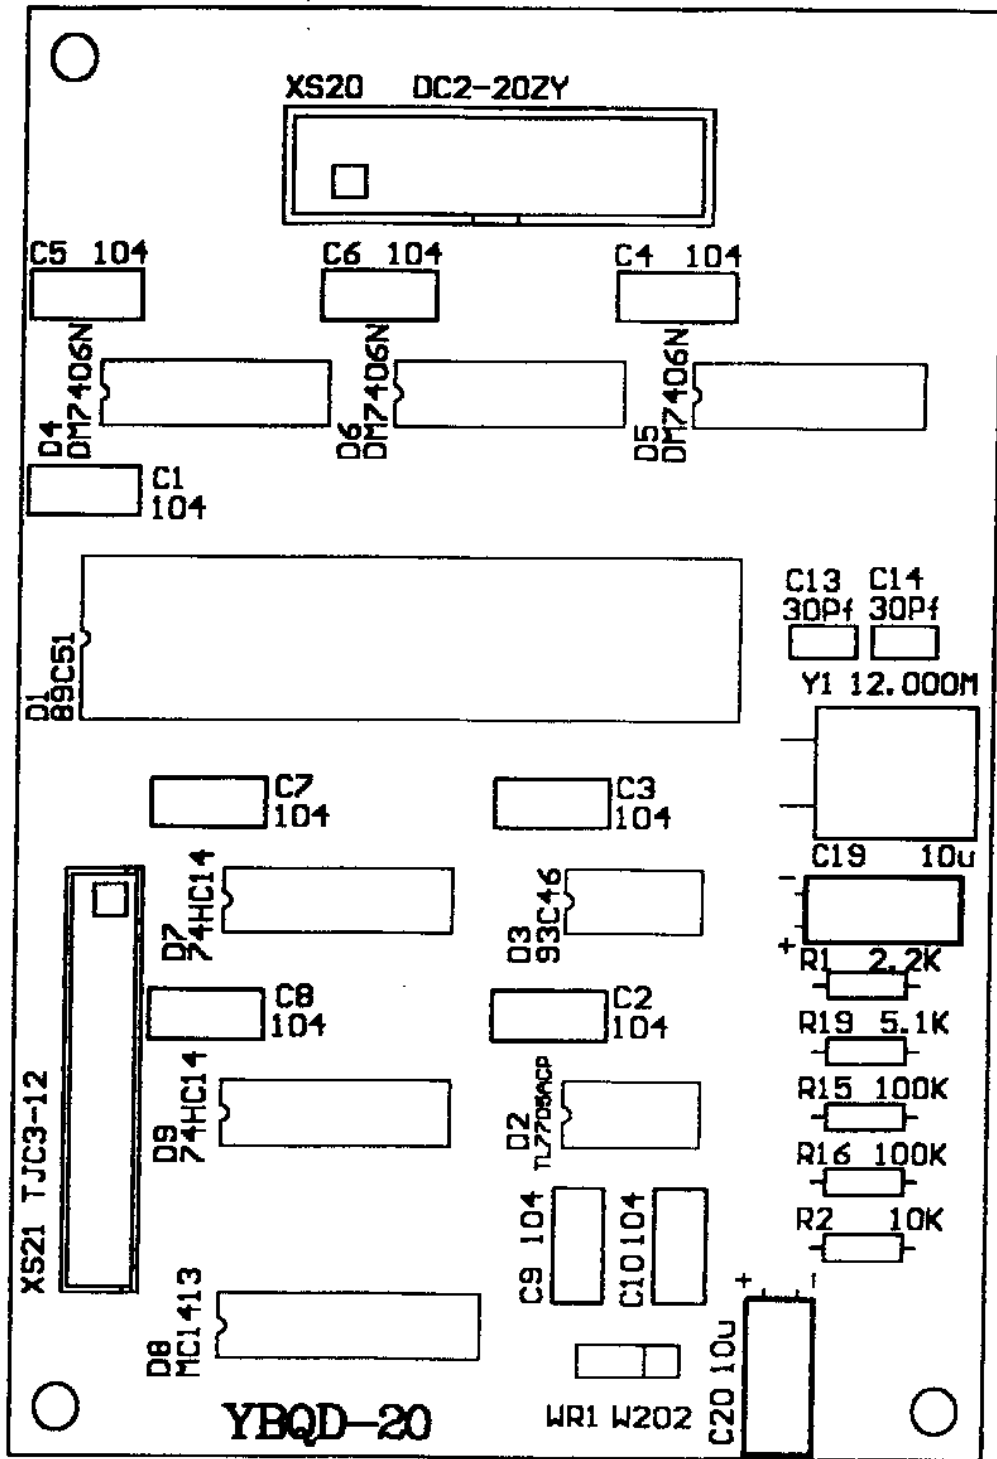


Fig.15 Component installing diagram of control board



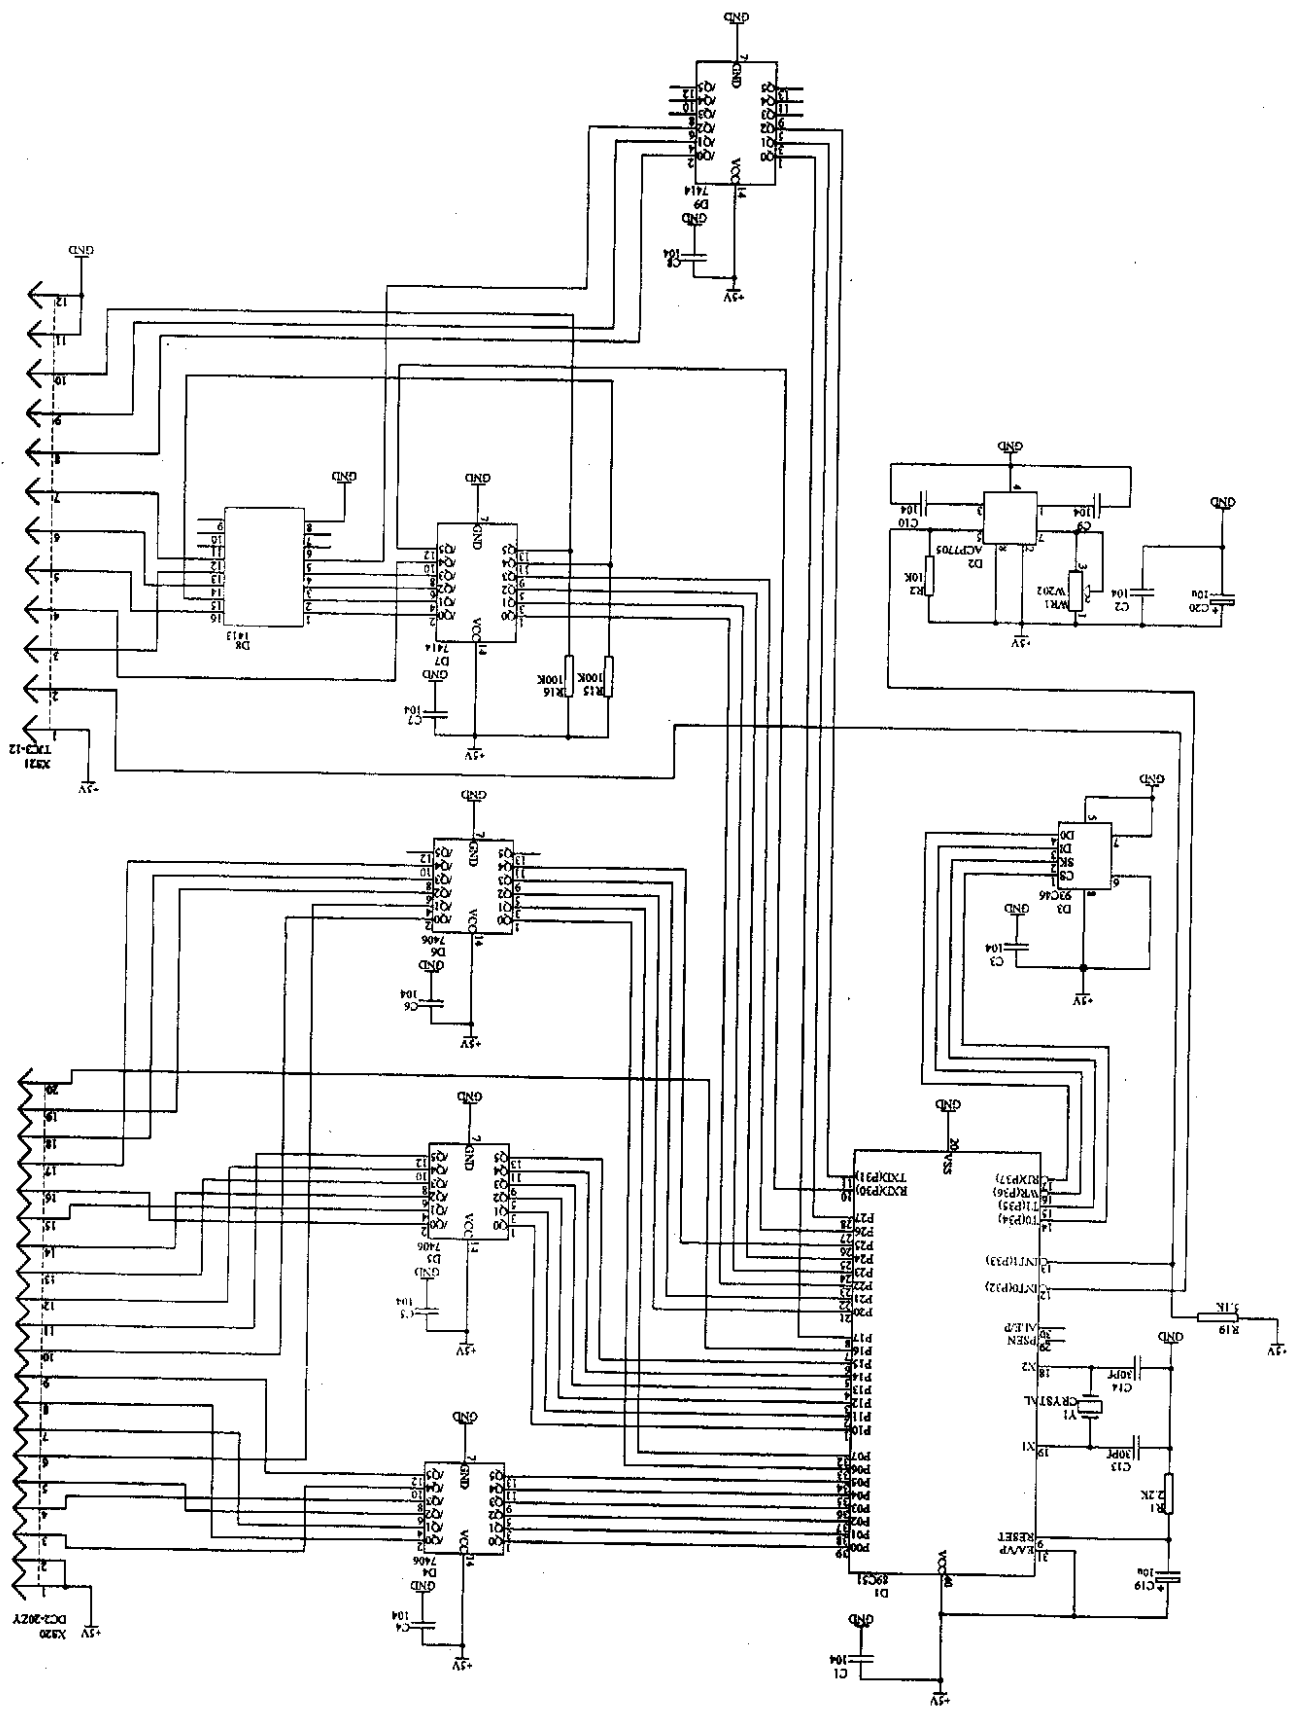


Fig.16 Electric circuit diagram of control board



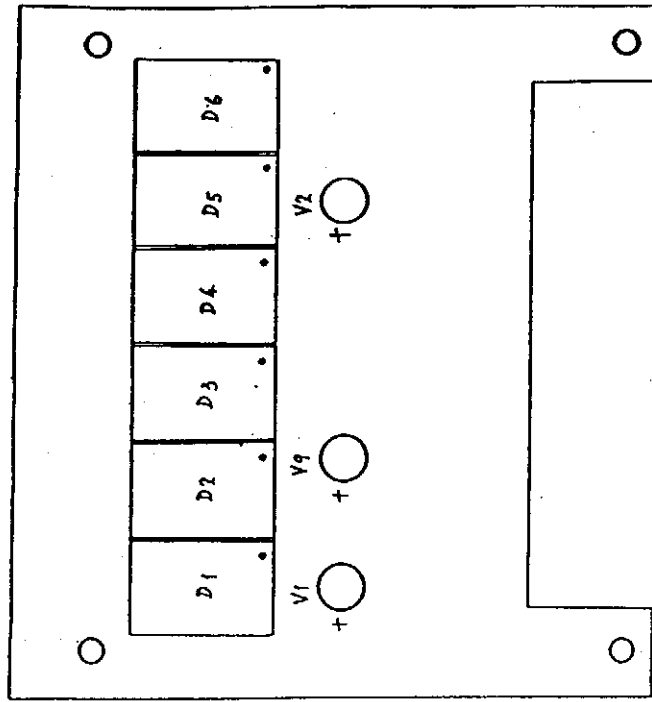

B

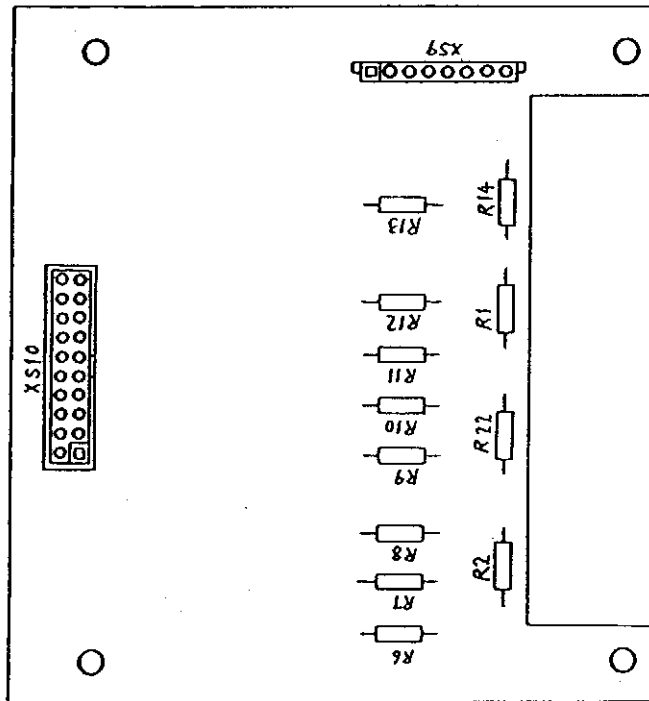

A

Fig.17 Component installing diagram of display board


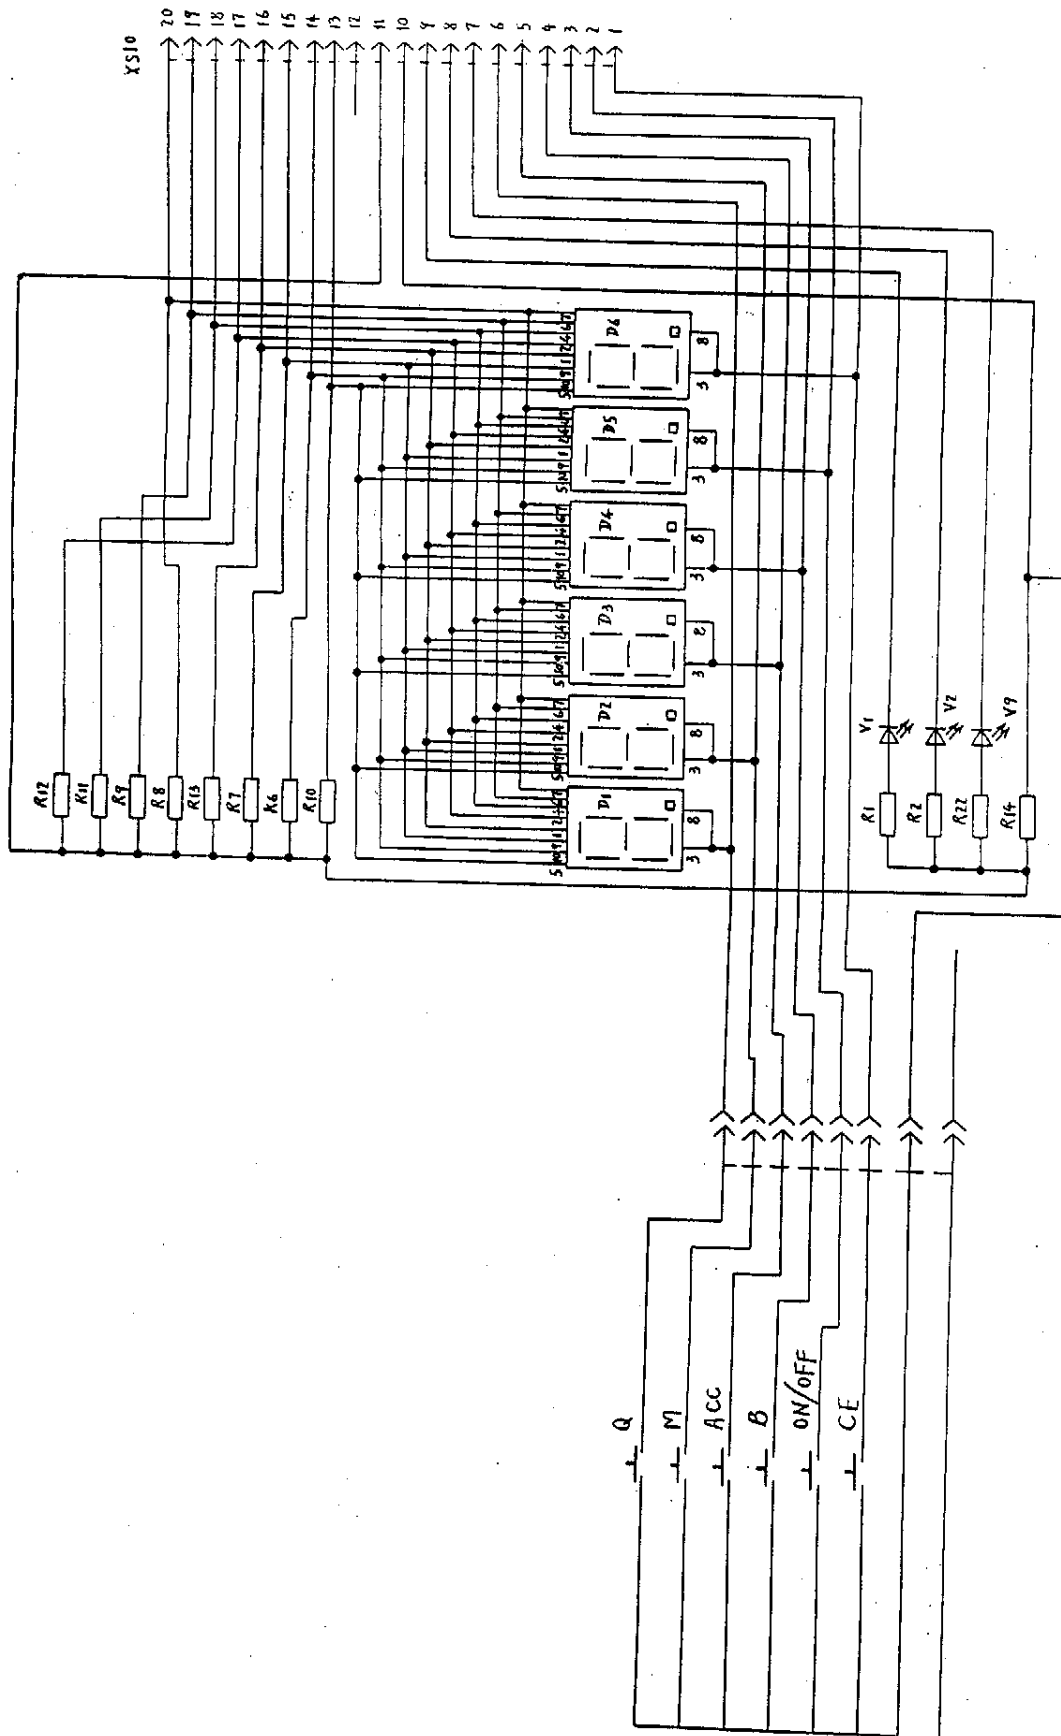


Fig.18 Electric circuit diagram of display board

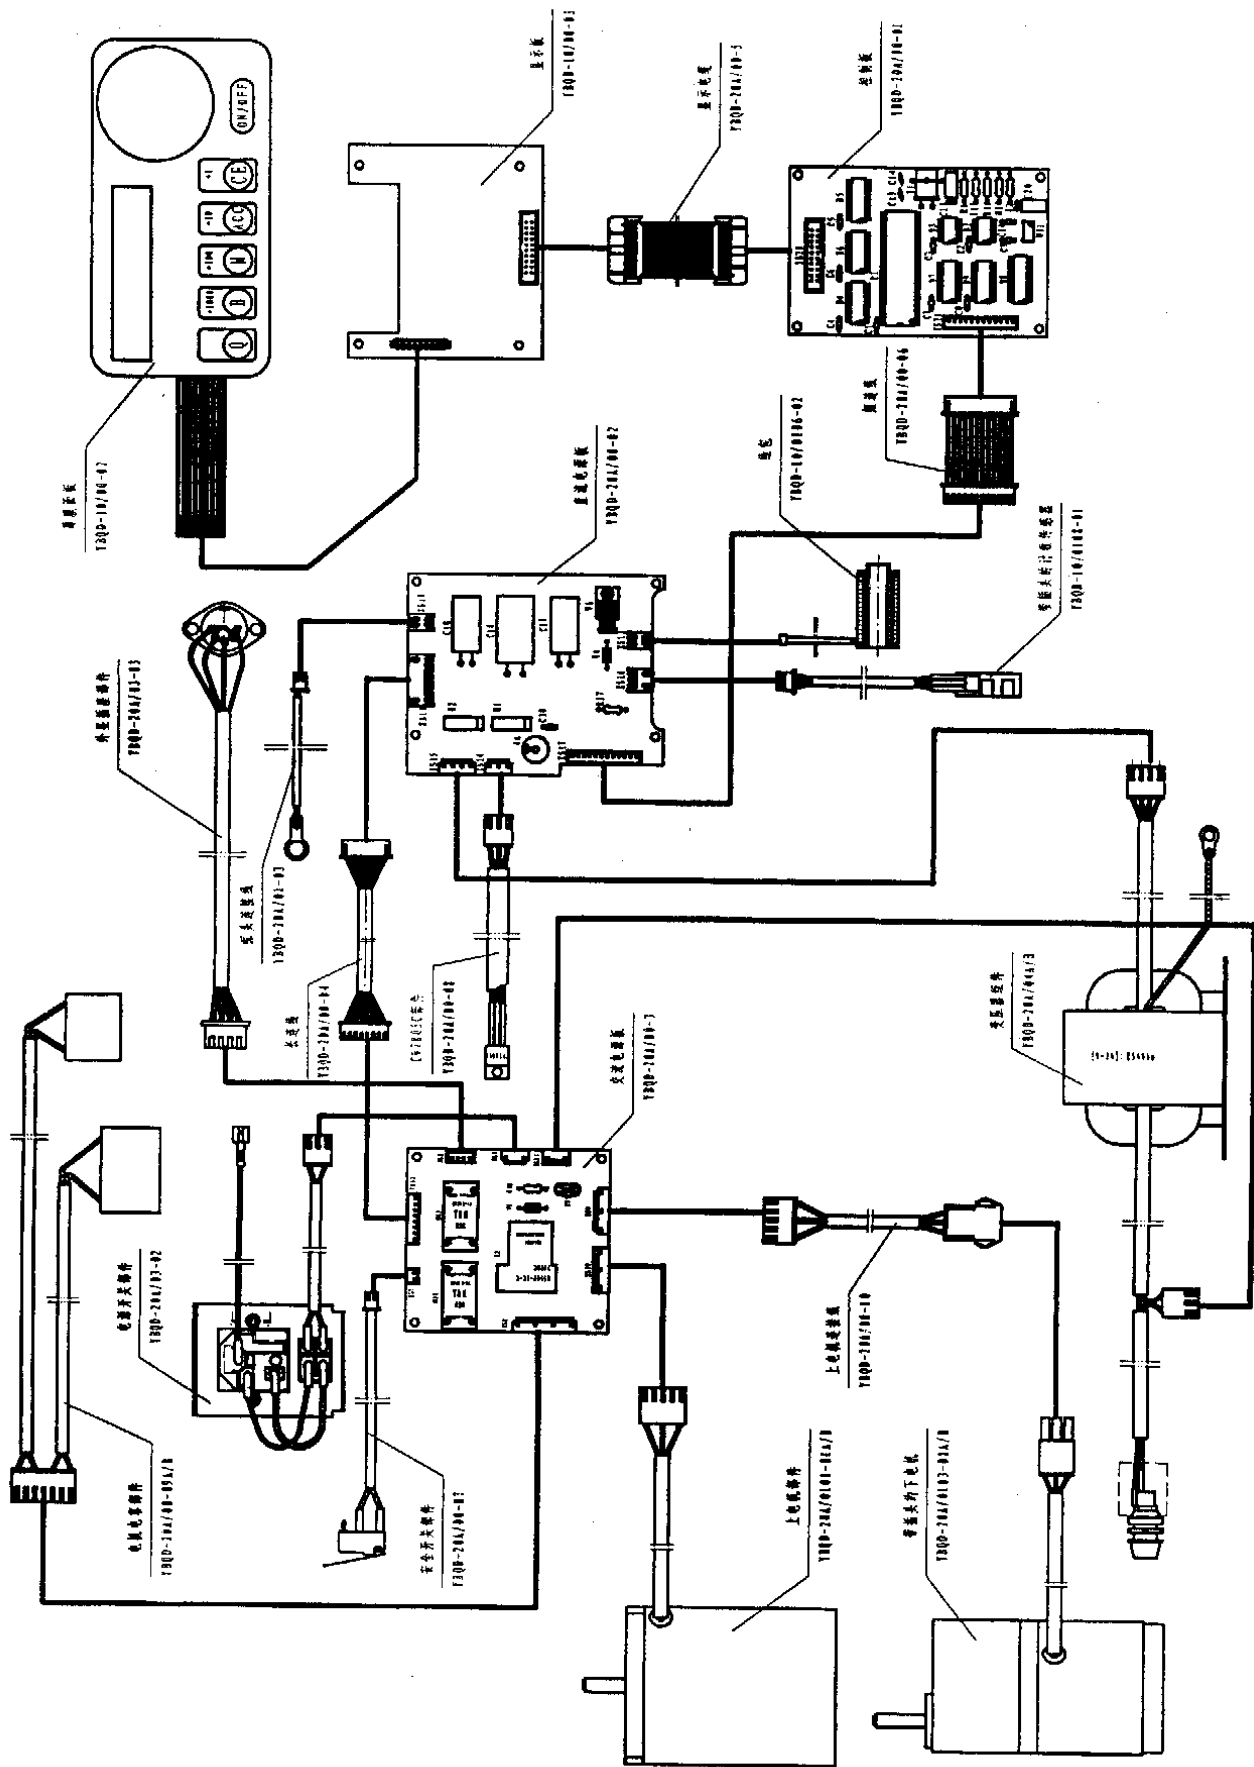

g.19 Wiring diagram of the machine